



Photo 26 - Loft southeast corner. Ceiling consumed by fire and collapsed onto floor. Noticed wood timber lintel. Parapet above front windows is unstable.



Photo 27 - Loft southeast corner. Ceiling consumed by fire and collapsed onto floor. Gypsum board has been pulled off of interior partition.





Photo 28 - Loft southwest unit. Collapsed ceiling and walls.



Photo 29 - Loft southwest unit looking west. Collapsed ceiling and walls.





Photo 30 - Loft southwest unit looking north. Ceiling joists consumed by fire has fallen onto interior partition



Photo 31 - Loft southwest unit looking south. Ceiling and walls collapsed onto floor.





Photo 32 - Loft southwest unit looking south along west wall at window. Window & frame knocked out, damaged brick





Photo 33 - Loft southwest unit looking north. Roof joists consumed by fire, roof and partition walls have collapsed.



Photo 34 - Loft northeast unit looking north: ceiling collapse. Location where delaminated brick was noted.





Photo 35 - Loft northeast unit looking at northeast corner of building. Ceiling collapse.



Photo 36 - Loft northeast unit looking east. Example of brick construction - missing bricks are piled on the floor not just below the bottom of this picture.





Photo 37 - Loft northeast unit looking east. Example of brick construction - sealant is evident in the darker colored brick. Where sealed the mortar is hard on the exterior of the brick, but soft 1/2" or so within the brick wall.

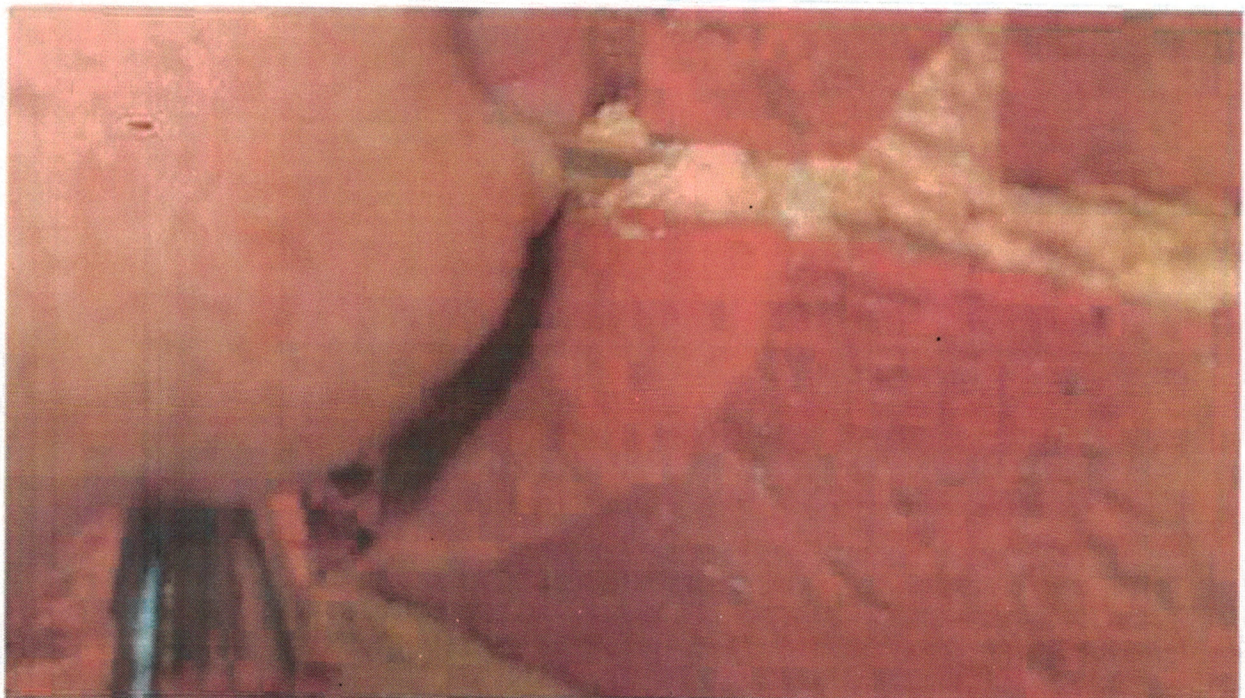




Photo 38 - Loft northeast unit looking east. Example of brick construction - Mortar is soft and can be scraped out with my key.



Photo 39 - loft northeast unit looking at same damaged area to brick. Interior face of brick has moved approximately 1" or more from interior wythes. Mortar not bonding - notice the lack of mortar on the face of brick units





Photo 41 - West face of building.



Photo 42 - West face of building.